

5V SECTION

2 GROOVES

Dimensions

O.D.	Datum dia.	Part No.	List Price	Mult. Sym.	F = 1 11/16 inches					
					H	Type	B	L	E	Approx. Wt. (lbs)
4.40	4.30	2-5V4.40 ²	73.00	QDS08	15/32	6B	SH	1 1/4	29/32	3.4
4.65	4.55	2-5V4.65 ^{1*}	79.00	QDS08	11/16	11B	SDS	1 5/16	1 1/16	3.6
4.90	4.80	2-5V4.90	85.00	QDS08	7/32	4B	SDS	1 5/16	3/8	3.9
5.20	5.10	2-5V5.20	91.00	QDS08	7/32	6B	SDS	1 5/16	19/32	4.8
5.50	5.40	2-5V5.50	97.00	QDS08	7/32	6B	SDS	1 5/16	19/32	5.5
5.90	5.80	2-5V5.90	103.00	QDS08	7/32	6B	SDS	1 5/16	19/32	6.5
6.30	6.20	2-5V6.30	109.00	QDS08	7/16	6B	SK	1 7/8	1/4	9.6
6.70	6.60	2-5V6.70	115.00	QDS08	7/16	6B	SK	1 7/8	1/4	9.3
7.10	7.00	2-5V7.10	120.00	QDS08	3/8	6B	SK	1 7/8	3/16	10.6
7.50	7.40	2-5V7.50	122.00	QDS08	3/8	6B	SK	1 7/8	3/16	12.1
8.00	7.90	2-5V8.00	124.00	QDS08	3/8	6B	SK	1 7/8	3/16	14.3
8.50	8.40	2-5V8.50	128.00	QDS08	3/8	6B	SK	1 7/8	3/16	16.2
9.00	8.90	2-5V9.00	136.00	QDS08	3/8	6B	SK	1 7/8	3/16	18.5
9.25	9.15	2-5V9.25	144.00	QDS08	3/8	6W	SK	1 7/8	3/16	17.0
9.75	9.65	2-5V9.75	148.00	QDS08	3/8	6W	SK	1 7/8	3/16	18.2
10.30	10.20	2-5V10.30	152.00	QDS08	3/8	6W	SK	1 7/8	3/16	18.0
10.90	10.80	2-5V10.90	156.00	QDS08	3/8	6W	SK	1 7/8	3/16	20.8
11.30	11.20	2-5V11.30	160.00	QDS08	3/8	6A	SK	1 7/8	3/16	16.9
11.80	11.70	2-5V11.80	162.00	QDS08	3/8	6A	SK	1 7/8	3/16	18.6
12.50	12.40	2-5V12.50	164.00	QDS08	3/8	6A	SF	2	1/16	20.8
13.20	13.10	2-5V13.20	176.00	QDS08	3/8	6A	SF	2	1/16	22.0
14.00	13.90	2-5V14.00	230.00	QDS08	3/8	6A	SF	2	1/16	24.8
15.00	14.90	2-5V15.00	234.00	QDS08	3/8	6A	SF	2	1/16	26.6
16.00	15.90	2-5V16.00	252.00	QDS08	3/8	6A	SF	2	1/16	34.9
18.70	18.60	2-5V18.70	300.00	QDS08	3/8	6A	SF	2	1/16	43.8
21.20	21.10	2-5V21.20	416.00	QDS08	3/8	6A	SF	2	1/16	43.8
23.60	23.50	2-5V23.60	480.00	QDS08	5/16	5A	E	2 5/8	5/8	61.7
28.00	27.90	2-5V28.00	520.00	QDS08	5/16	5A	E	2 5/8	5/8	73.0

P.D. for "5V" Belts = O.D.


¹ Reverse mount only.

² This sheave can only be reverse mounted with standard bushing bolts.


Specials bolts (not provided by Baldor) are required for standard mount.

* Mounting bolts are supplied by Baldor with these parts.


Type of sheave "T": A = arms; B = block; W = web

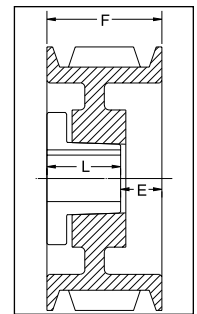


TYPE 4

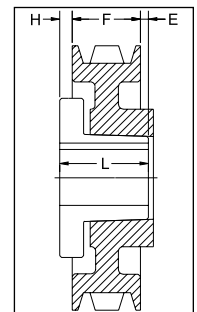

TYPE 5

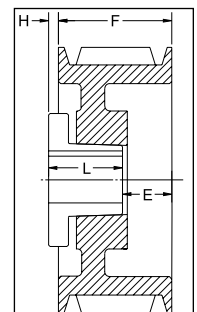

TYPE 6

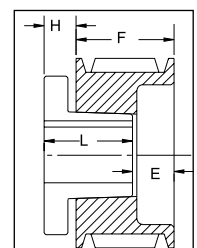

TYPE 11

Gearmotors and Gear Products

PT Components

Motor Accessories

Grinders

Generators

Servo Motors and Controls

Mod Express

Baldor Education Workshops

Classifications and Sales Offices

EISA Compliance Table & Index