

# Transformer Cooling Fan Replacement

## TEAO, Single Speed, Rigid Base



### Features:

- External cooling air required
- Reversible rotation
- Ball Bearings
- Optional extended clamp screws
- Z shaft is .50 x 2.25" with 1.91" Flat

### Single Phase


HP	RPM	VOLTS	FRAME	CAT. NO.	MODEL NO.	STOCK	LIST PRICE	MULT. SYMB.	F.L. AMPS	"C" DIM.	FOOT NOTES
1/20	1625	115/200-230	48Z	PG240	5KCP35CNA490S	★	\$304	F1	1.5/0.7-0.8	10.32	9,25,50,94,113
1/3	1075	115/200-230	56Z	P241	5KCP36RNA491S	★	\$384	F1	4.4/2.1-2.2	10.75	9,25,50,94,113

### Three Phase

HP	RPM	VOLTS	FRAME	CAT. NO.	MODEL NO.	STOCK	LIST PRICE	MULT. SYMB.	F.L. AMPS	"C" DIM.	FOOT NOTES
1/3	1200	200-230/460	56	K1487	5K49MN6126T	★	\$539	F1	2.1-2.0/1.0	10.38	68,113

## Unit Heater Fan, PSC, TEAO

### Resilient Base

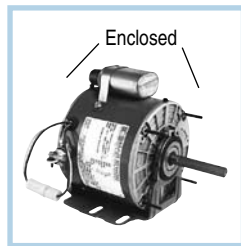

### Applications:

Replacement motors for unit heaters. Air over motors need to be mounted within the airstream for proper cooling.

### Features:

- Totally enclosed
- Direct drive, air over
- Ball Bearings
- Horizontal or vertical mount
- Weather resistant reversing plug
- BX connector mounted in frame
- 1" Extended thru-bolts
- 48Y Frame has non-standard BA dimension
- Automatic reset thermal protection
- UL Recognized and CSA Certified
- **Capacitor included**

HP	RPM	VOLTS	FRAME	CAT. NO.	MODEL NO.	STOCK	LIST PRICE	MULT. SYMB.	F.L. AMPS	FRAME LENGTH	SHAFT DIM.	FOOT NOTES
1/6	1625	115	48Y	X305	48A17T2001	★	\$153	F1	2.0	4 3/4	1/2 x 2 3/4	
	1625	115	48Y	X301	48A17T72	★	\$136	F1	2.0	5 1/4	1/2 x 2 3/4	
	1075	115	48Y	X306	48A11T2005	★	\$158	F1	3.0	4 3/4	1/2 x 2 3/4	d
	1075	115	48Y	X302	48A11T199	★	\$158	F1	3.0	4 3/4	1/2 x 2 3/4	
1/4	1075	115	48Y	X307	48A11T2006	★	\$166	F1	4.1	4 3/4	1/2 x 2 3/4	d
	1075	115	48Y	X303	48A11T198	★	\$166	F1	4.1	4 3/4	1/2 x 2 3/4	
1/3	1075	115	48Y	X304	48A11T201	★	\$183	F1	6.5	21	1/2 x 2 3/4	
	1075	115	48Y	X308	48A11T2007	★	\$183	F1	6.5	20	1/2 x 2 3/4	d

## Circulator Pump, Split Phase

### Dripproof, Resilient Ring



### Applications:

Direct replacements for Taco hot water circulators.

### Features:

- Quiet sleeve bearing construction
- 48Z frame with 1/2" diameter shaft, 1" long without flat
- 1.40 Service Factor (except as noted)
- Fixed CCW rotation, viewed opposite shaft end
- 4722 replaces Taco No. 110-388, Marathon No. 48S17D1027, 48S17D2102
- 4404 replaces GE No. 5KH32EG129GA, Marathon No. 48S17D1084
- UL Recognized and CSA Certified

HP	RPM	VOLTS	FRAME	CAT. NO.	MODEL NO.	STOCK	FORMER CAT.NO.	FORMER MODEL NO.	LIST PRICE	MULT. SYMB.	F.L. AMPS	"C" DIM.	FOOT NOTES
1/12	1800	115	48Y	4722	5KH39QN5558T	★	X700	48S17D2102	\$108	F1	2.1	7.29	4
1/8	1800	115	48Y	4404	5KH39QN5550X	★	X701	48S17D1084	\$117	F1	2.6	8.93	4
1/4	1800	115	48Y	HG716	5KH36DNA780X	★			\$258	F1	5.7	9.01	4,17
1/3	1800	115	48Y	HG717	5KH37GNA782X	★			\$275	F1	6.2	9.41	4,17