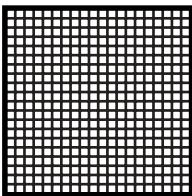
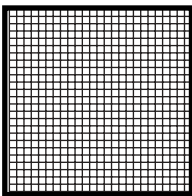
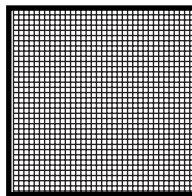
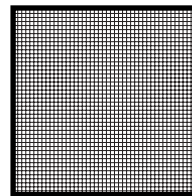
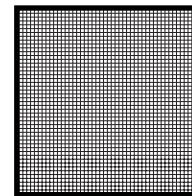
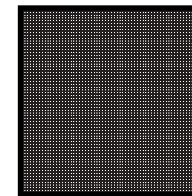
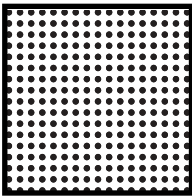
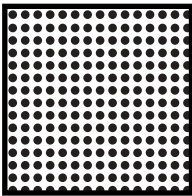
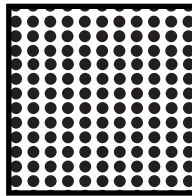
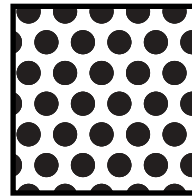
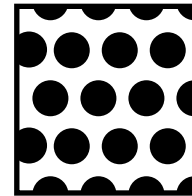
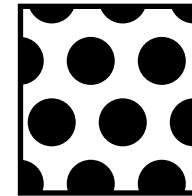


Screen and Basket Facts


Wire Cloth Finer Than 100 Mesh Is Available - Upon Application

$\frac{1}{32}$ " Openings	$\frac{1}{60}$ " Openings	$\frac{1}{64}$ " Openings	.009 Openings	.007 Openings	.005 Openings
					
20 Mesh (52% Open Area) .014 Wire Dia	30 Mesh (41% Open Area) .012 Wire Dia	40 Mesh (36% Open Area) .010 Wire Dia	60 Mesh (30.5% Open Area) .0075 Wire Dia	80 Mesh (31.4% Open Area) .0055 Wire Dia	100 Mesh (30.3% Open Area) .0045 Wire Dia

We Stock Many Perforations Other Than Those Illustrated.

					
.033 Dia ($\frac{1}{32}$ "") 324 Holes/Sq in. 28% Open Area	.045 Dia ($\frac{3}{64}$ "") 225 Holes/Sq in. 36% Open Area	.062 Dia ($\frac{1}{16}$ "") 132 Holes/Sq in. 37% Open Area	$\frac{1}{10}$ " Dia 49 Holes/Sq in. 39% Open Area	$\frac{1}{8}$ " Dia 32 Holes/Sq in. 40% Open Area	$\frac{5}{32}$ " Dia 33 Holes/Sq in. 62% Open Area

SCREENS FOR "Y" STRAINERS BOTH SCREWED* AND FLANGED

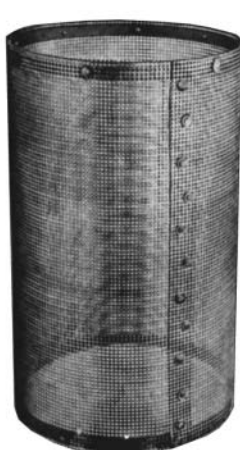

Perforated metal
spot welded
or riveted seams

BASKETS FOR #125 STRAINERS*



Perforated metal
lined with wire mesh

BASKETS FOR #155, 165, 166, 185, & 186 STRAINERS



Perforated metal
spot welded
or riveted seams



Perforated metal
lined with wire mesh

*11M Screwed Strainers up to 2" Size Normally Furnished with 20 Mesh Screens.

Consult Factory for fine straining for perforated and mesh combinations and for materials other than standard.

