

5V SECTION

4 GROOVES

Dimensions


O.D.	Datum dia.	Part No.	List Price	Mult. Sym.	F = 3 1/16 inches					
					H	Type	B	L	E	Approx. Wt. (lbs)
4.40	4.30	4-5V4.40¹*	92.00	QDS08	11/16	11B	SD	1 13/16	1 15/16	5.4
4.65	4.55	4-5V4.65¹*	98.00	QDS08	11/16	11B	SD	1 13/16	1 15/16	6.1
4.90	4.80	4-5V4.90*	104.00	QDS08	5/8	1B	SD	1 13/16	5/8	6.5
5.20	5.10	4-5V5.20	110.00	QDS08	5/8	1B	SD	1 13/16	5/8	8.2
5.50	5.40	4-5V5.50	116.00	QDS08	5/8	1B	SD	1 13/16	5/8	9.4
5.90	5.80	4-5V5.90	122.00	QDS08	5/8	1B	SD	1 13/16	5/8	10.0
6.30	6.20	4-5V6.30	128.00	QDS08	1/2	1B	SK	1 7/8	11/16	11.7
6.70	6.60	4-5V6.70	134.00	QDS08	1/2	1B	SK	1 7/8	11/16	13.4
7.10	7.00	4-5V7.10	140.00	QDS08	0	4B	SF	2	1 1/16	14.5
7.50	7.40	4-5V7.50	148.00	QDS08	0	4B	SF	2	1 1/16	16.3
8.00	7.90	4-5V8.00	156.00	QDS08	0	4B	E	2 5/8	7/16	17.9
8.50	8.40	4-5V8.50	162.00	QDS08	0	4B	E	2 5/8	7/16	21.7
9.00	8.90	4-5V9.00	164.00	QDS08	0	4B	E	2 5/8	7/16	24.4
9.25	9.15	4-5V9.25	168.00	QDS08	0	4B	E	2 5/8	7/16	26.2
9.75	9.65	4-5V9.75	196.00	QDS08	3/8	1B	E	2 5/8	1/16	29.4
10.30	10.20	4-5V10.30	200.00	QDS08	0	4W	E	2 5/8	7/16	28.6
10.90	10.80	4-5V10.90	206.00	QDS08	0	4W	E	2 5/8	7/16	30.3
11.30	11.20	4-5V11.30	224.00	QDS08	3/8	1W	E	2 5/8	1/16	30.9
11.80	11.70	4-5V11.80	226.00	QDS08	0	4W	E	2 5/8	7/16	32.5
12.50	12.40	4-5V12.50	234.00	QDS08	3/8	1A	E	2 5/8	1/16	35.0
13.20	13.10	4-5V13.20	256.00	QDS08	0	4A	E	2 5/8	7/16	37.4
14.00	13.90	4-5V14.00	290.00	QDS08	0	4A	E	2 5/8	7/16	41.1
15.00	14.90	4-5V15.00	320.00	QDS08	0	4A	E	2 5/8	7/16	43.7
16.00	15.90	4-5V16.00	340.00	QDS08	0	4A	E	2 5/8	7/16	46.9
18.70	18.60	4-5V18.70	380.00	QDS08	3/16	1A	E	2 5/8	1/4	58.5
21.20	21.10	4-5V21.20	512.00	QDS08	3/16	1A	E	2 5/8	1/4	77.0
23.60	23.50	4-5V23.60	546.00	QDS08	21/32	6A	F	3 5/8	3/32	98.0
28.00	27.90	4-5V28.00	620.00	QDS08	21/32	6A	F	3 5/8	3/32	118.0
31.50	31.40	4-5V31.50	970.00	QDS10	11/32	5A	F	3 5/8	7/32	141.0
37.50	37.40	4-5V37.50	1240.00	QDS10	21/32	6A	F	3 5/8	3/32	178.0
50.00	49.90	4-5V50.00	1880.00	QDS10	15/16	5A	J	4 1/2	1/2	269.0

P.D. for "5V" Belts = O.D.


¹ Reverse mount only.

* Mounting bolts are supplied by Baldor with these parts.


Type of sheave "T": A = arms; B = block; W = web

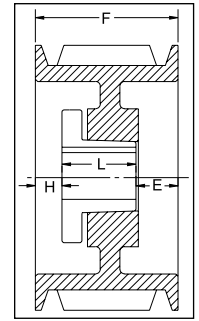


TYPE 1

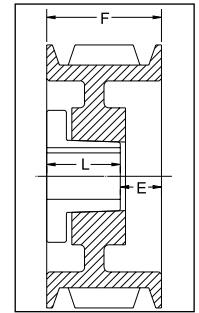


TYPE 4

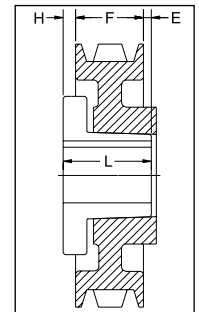

TYPE 5

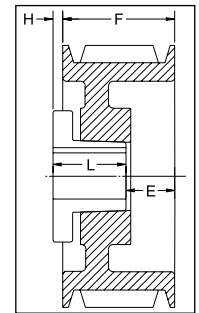

TYPE 6

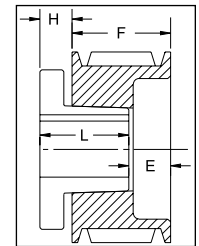

TYPE 11

Gearmotors and Gear Products

PT Components

Motor Accessories

Grinders

Generators

Servo Motors and Controls

Mod Express

Baldor Education Workshops

Classifications and Sales Offices

EISA Compliance Table & Index